




I N F I N I T I

Orlando Infiniti

INVOICE - CUSTOMER COPY

This form is an itemized list of repairs and is part of the original Repair Order. This Repair Order Continuation is subject to all of the terms...

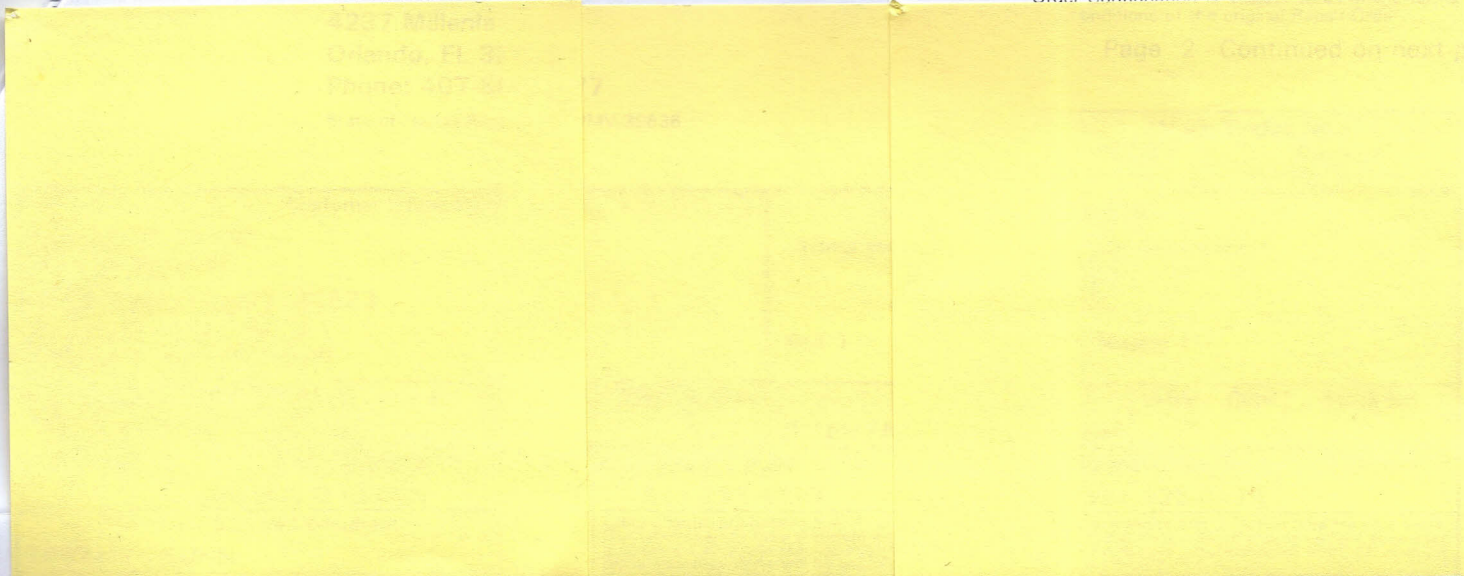

Page

06 CUSTOMER STATES THE INTOUCH SCREEN FREEZES SOMETIMES
VARIFIED CONCERN AFTER TESTING EXTENSIVELY, LATEST SOFTWARE
INSTALLED. REPLACED A/V UNIT PER DTS AND TESTED

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 341.53 Factory

07 CUSTOMER STATES DAS MALFUNCTION AND ALARMS A FEW TIMES.
ALMOST LOST CONTROL DUE TO LOSS OF STEERING.
WORKED WITH DTS. REPLACED ALL 3 DAS MODULES AND RECALIBRATED
TESTED EXTENSIVELY. COULD NOT RECREATE CONCERN AT THIS TIME

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 950.34 Factory

Parts	Qty	Each	Parts
CONTROLLER ASSY-POWE-285H0-4GA5J	ASR 1	687.53	687.53 Factory
CONTROLLER ASSY-POWE-28505-4GA6J	ASR 1	576.71	576.71 Factory
CONTROLLER ASSY-POWE-28505-4GA1J	ASR 1	687.53	687.53 Factory

08 CUSTOMER STATES THE IPOD DOES NOT WORK PROPERLY. SAYS ONE
SONG WHEN YOU ARE LISTENING TO ANOTHER
REFER TO LINE #7

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 No Charge Dealer

09 CUSTOMER STATES THE VEHICLE SURGES WHILE IN CRUISE CONTROL.
BOBS LIKE YOU ARE ON A BOAT AND FUEL METER FLUCUATES
VARIFIED CONCERN WITH DTS
AWAITING UPDATE FROM ENGINEERING TO CORRECT ISSUE

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 163.34 Factory

10 CUSTOMER STATES UPPER AC VENTS STOP BLOWING AIR AT TIMES
AND YOU HAVE TO RESTART THE CAR FOR IT TO WORK AGAIN
TESTED NUMEROUS TIMES AND UNABLE TO RECREATE CONCERN
SUSPECT CONCERN CAUSED BY A/V ISSUE. CUSTOMER TO MONITOR

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 No Charge Dealer

11 CUSTOMER STATES RANDOMLY THE COLLISION ALARMS WILL COME ON
AND STAY ON UNTIL YOU RESTART CAR
ROADTESTED AND RAN DTC'S WITH DTS
POSSIBLE ISSUE RESOLVED BY REPLACEMENT OF DAS MODULES

GENERAL REPAIRS-GENRP Add-On? Tec1 Labor
No ITWA01 133.64 Factory

Page 2 Continued on next page

Original Estimate	Total Revised Estimate	Miscellaneous Shop Supplies and Hazardous Waste Removal Charge: 11% of the labor charge to a maximum of \$99 is included in supplies used on your vehicle. This charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies or waste disposal. FS403.718 mandates a \$1.00 fee for each new tire sold in the State of Florida. FS403.7145 mandates a \$1.50 fee for each new or remanufactured battery sold in the State of Florida.
\$	\$	
I acknowledge notice and oral approval of an increase in the original estimated price.		I acknowledge receipt of the parts and/or labor listed above. I have read reverse side for important and additional terms and conditions.
CUSTOMER SIGNATURE x		CUSTOMER SIGNATURE x




I N F I N I T I

Orlando Infiniti

INVOICE - CUSTOMER COPY

This form is an itemized list of repairs and is part of the original Repair Order. This Repair Order Continuation is subject to all of the terms and conditions of the original Repair Order.

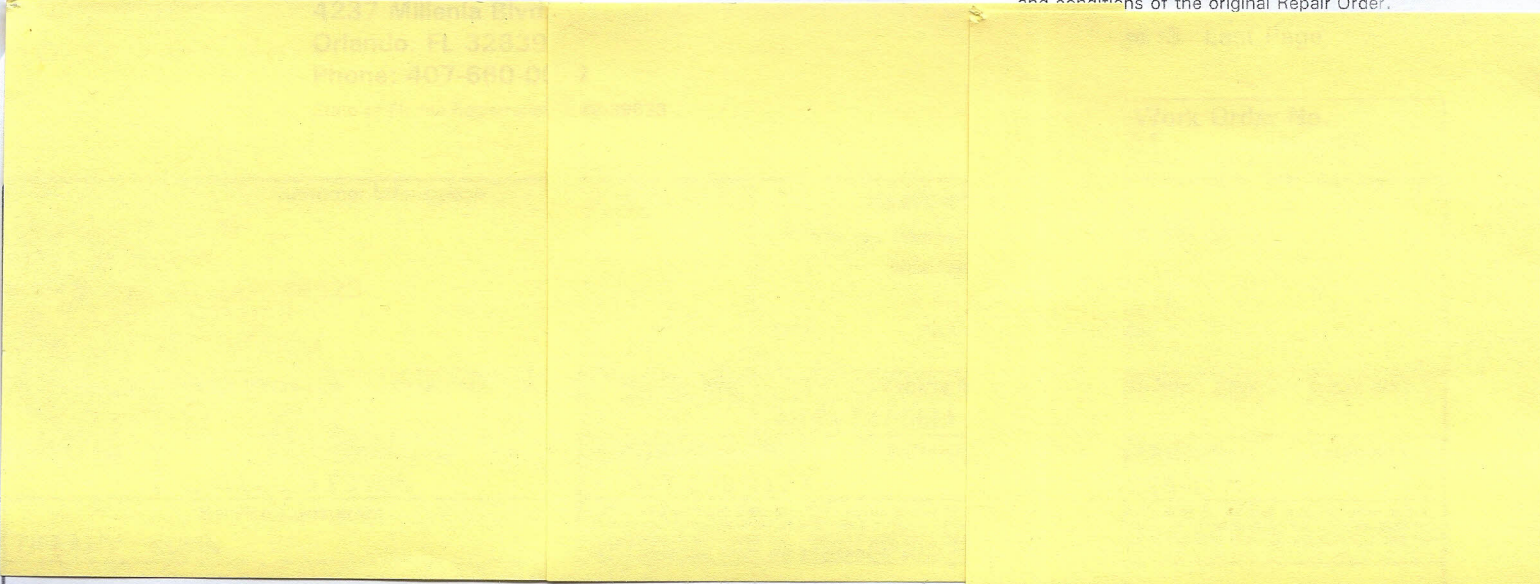

12 CUSTOMER STATES HE WOULD LIKE IT NOTED THAT HE IS STILL WAITING FOR THE INTOUCH SOFTWARE UPGRADE FOR APPS AFTER REPLACEMENT OF A/V UNIT CHECKED FIRMWARE LATEST UPDATE UPLOADED IN SYSTEM

GENERAL REPAIRS-GENRP

Add-On? Tec1 Labor
No ITW\01 No Charge Dealer

13 Complimentary Inspection-INSP

Add-On? Tec1 Labor
No ITW\01 No Charge Dealer

BEFORE L/F 0.11MM R/F 0.14MM
AFTER L/F 0.01MM R/F 0.02MM

```

*****
* Totals Amount *
* Total.....: No Charge Customer*
* Labor.....: 2,509.50 *
* Parts.....: 1,951.77 *
* Total.....: 4,461.27 Factory *
*****

```

Page 3 Last Page

Original Estimate \$	Total Revised Estimate \$	Miscellaneous Shop Supplies and Hazardous Waste Removal Charge: 11% of the labor charge to a maximum of \$99 is included in supplies used on your vehicle. This charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies or waste disposal. FS403.718 mandates a \$1.00 fee for each new tire sold in the State of Florida. FS403.7135 mandates a \$1.50 fee for each new or remanufactured battery sold in the State of Florida.
I acknowledge notice and oral approval of an increase in the original estimated price. CUSTOMER SIGNATURE x	I acknowledge receipt of the parts and/or labor listed above. I have read reverse side for important and additional terms and conditions. CUSTOMER SIGNATURE x	




I N F I N I T I

Orlando Infiniti
4237 Millenia Blvd.
Orlando, FL 32839

INVOICE - CUSTOMER COPY

This form is an itemized list of repairs and is part of the original Repair Order. This Repair Order Continuation is subject to all of the terms and conditions of the original Repair Order.

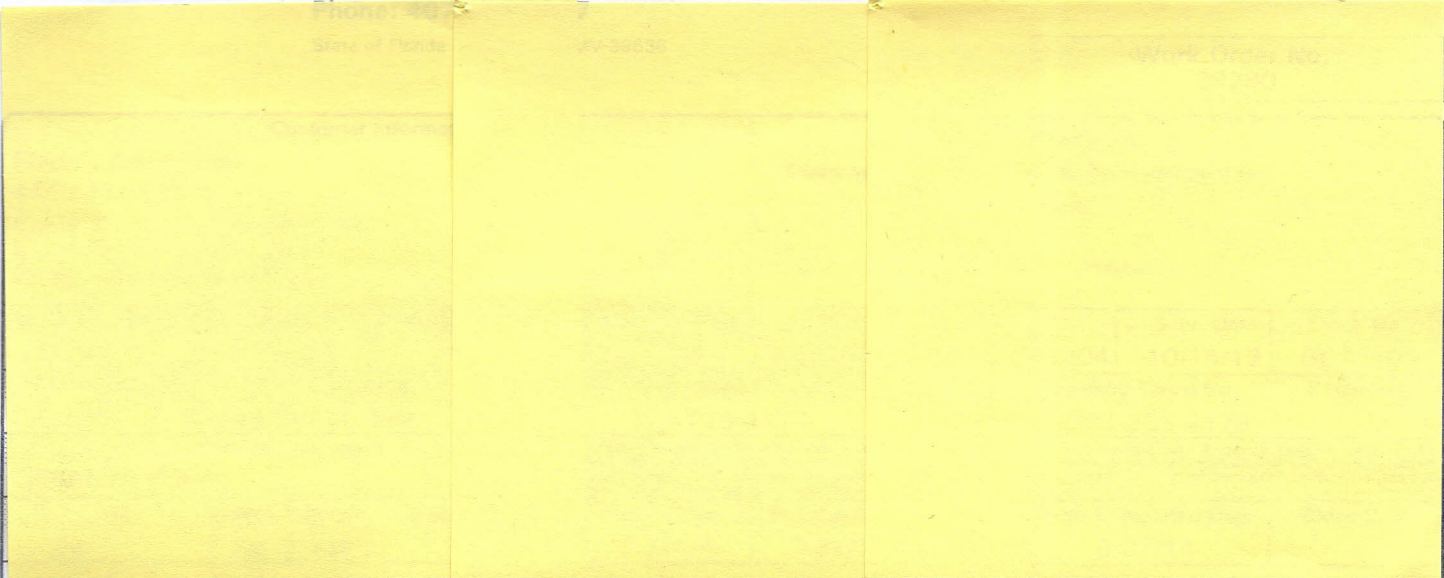

01 NOT PERFORMED AT THIS TIME COMPLETED

ITB14-015 OCS REPROGRAM-R1404 Add-On? Tec Labor No ITWA01 No Charge Dealer

02 CUSTOMER STATES OIL AND FILTER CHANGE AND TIRE ROTATION COMPLETED

Every 5k or 6 Months-T0005 Add-On? Tec Labor No ITWA01 75.00 Customer

- Includes: Inspect battery condition-C0005
ENGINE OIL CHANGE SERVICE-U0400
Replace drain plug gasket-U0700
Insp All Fluid Levels-U0705
Check condition of wipers-W0031
Check Drive Belts-W0032
Check radiator hoses-W0033
Wash Exterior/vacuum mats-W0034
Tire Rotation-W0043

Table with 4 columns: Parts, Qty, Each, Parts. Rows include WASHER DRAIN-11026-JA00A, OIL FILTER-15208-65FOE, MOBILE SPECIAL 5W-30-01040.

Table with 4 columns: Expenses, Shop Supplies, ECC-ECC, SHP SUPPLY-SHP. Rows include ENV COMPLIANCE CHG, SHOP SUPPLIES.

03 CUSTOMER STATES THE INTOUCH DISPLAY IS NOT WORKING PROPERLY FOUND SOFTWARE ISSUE IN AUDIO UNIT REPLACED AUDIO UNIT AND RECONFIGURED UNIT. TESTED OK

GENERAL REPAIRS-GENRP Add-On? Tec Labor Yes ITWA01 118.79 Factory

Table with 4 columns: Expenses, Shop Supplies, SHP SUPPLY-SHP. Row includes SHOP SUPPLIES.


04 CUSTOMER STATES THE UPPER DISPLAY SCREEN IS NOT OPERATING PROPERLY FOUND HARDWARE ISSUE WITH UPPER DISPLAY REPLACED A/V UNIT AND TESTED

GENERAL REPAIRS-GENRP Add-On? Tec Labor Yes ITWA01 No Charge Factory

Table with 3 columns: Original Estimate, Total Revised Estimate, and acknowledgment text regarding hazardous waste removal charge and terms approval.

Orlando Infiniti

This form is an itemized list of repairs and is part of the original Repair Order. This Repair Order Continuation is subject to all of the terms

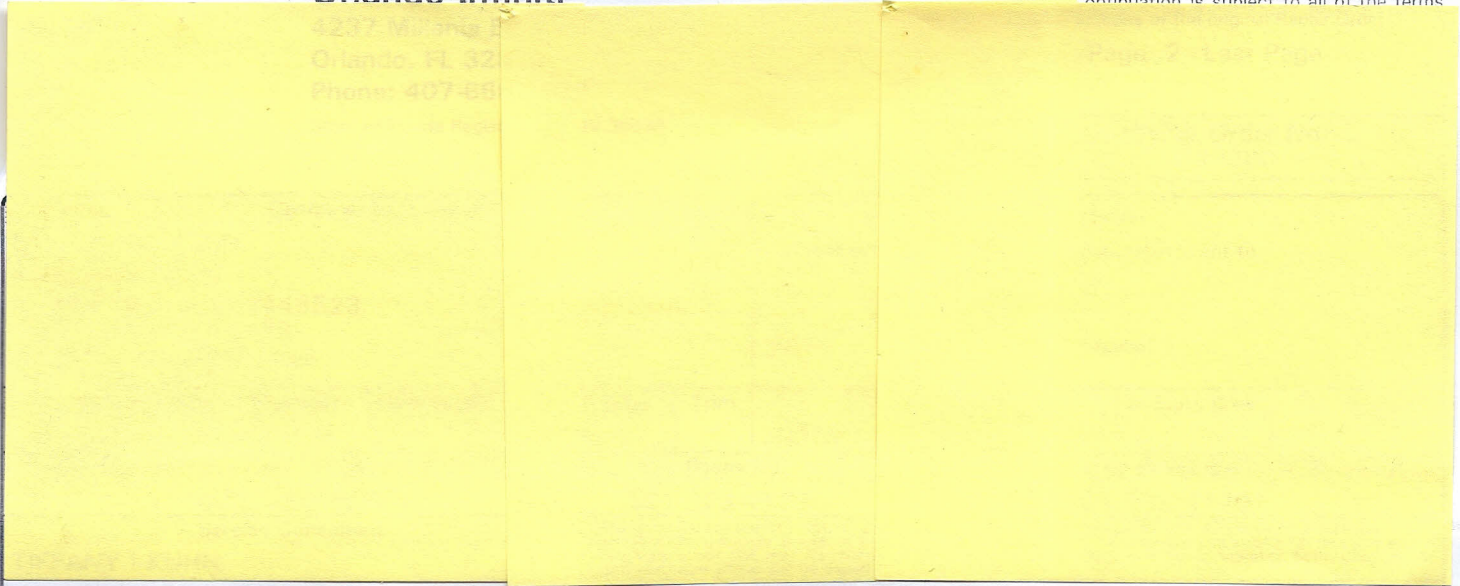

04 Continued...

Parts	Qty	Each	Parts	Factory
CONTROLLER ASSY-DISP-28387-4HB0C	1	2,749.76	2,749.76	Factory
Expenses			Expense	Factory
LNR/SERVICE-CLE			7.99	Factory
SHOP SUPPLIES			No Charge	Factory
VOR/CSC HANDLING-600			150.26	Factory

SHP SUPPLY-SHP

* Totals	Amount	*
* Labor.....	75.00	*
* Parts.....	21.52	*
* Expenses.....	10.00	*
* Tax.....	6.93	*
* Total.....	113.45	Customer*

* Labor.....	118.79	*
* Parts.....	2,749.76	*
* Expenses.....	171.32	*
* Tax.....	1.37	*
* Total.....	3,041.24	Factory*

Page 2 Last Page

Original Estimate	Total Revised Estimate	Miscellaneous Shop Supplies and Hazardous Waste Removal Charge: 11% of the labor charge to a maximum of \$99 is included in supplies used on your vehicle. This charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies or waste disposal. FS403.718 mandates a \$1.00 fee for each new tire sold in the State of Florida. FS403.718 mandates a \$1.50 fee for each new or remanufactured battery sold in the State of Florida.
\$	\$	
I acknowledge notice and oral approval of an increase in the original estimated price.		I acknowledge receipt of the parts and/or labor listed above. I have read reverse side for important and additional terms and conditions.
CUSTOMER SIGNATURE x		CUSTOMER SIGNATURE x